

|  |                        |   |
|--|------------------------|---|
| WAAS<br>CH <b>77599</b><br><b>W02A</b> | APP CRS<br><b>021°</b> | Rwy Idg <b>6501</b><br>TDZE <b>889</b><br>Apt Elev <b>889</b> |
|--|------------------------|---|

## RNAV (GPS) RWY 2

COLUMBIA RGNL (COU)

**T** For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -17°C (2°F) or above 54°C (130°F). Circling NA for Cat D west of Rwy 2 and 13. DME/DME RNP-0.3 NA. For inop ALS, increase LNAV/VNAV all Cts visibility to RVR 4500.


# RVR 1800 authorized with the use of FD or AP or HUD to DA.

MALSR



**MISSED APPROACH:** Climb to 3100 direct AGVOY and hold.

|                       |                                       |  |                         |                         |
|-----------------------|---------------------------------------|--|-------------------------|-------------------------|
| ATIS<br><b>128.45</b> | MIZZU APP CON<br><b>124.375 353.7</b> | COLUMBIA TOWER *<br><b>119.3 (CTAF) 0 363.25</b> | GND CON<br><b>121.6</b> | UNICOM<br><b>122.95</b> |
|-----------------------|---------------------------------------|--|-------------------------|-------------------------|

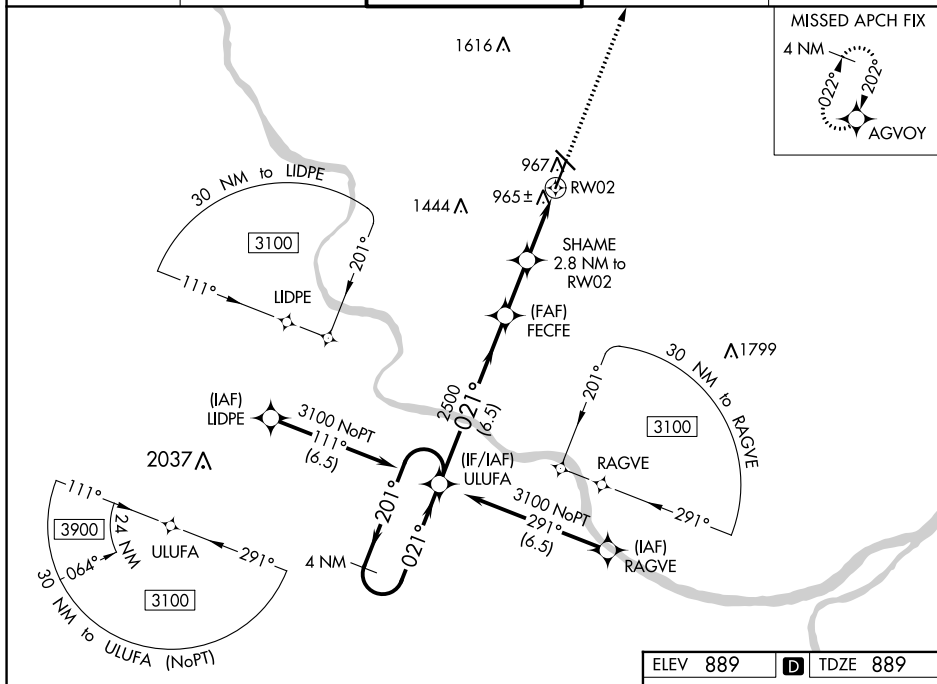

|          |          |          |
|----------|----------|----------|
| ELEV 889 | <b>D</b> | TDZE 889 |
|----------|----------|----------|

