APP CRS	Rwy Idg	10900
061°	TDZE	998
	Apt Elev	1009

RNAV (RNP) Y RWY 6L

JAMES M COX DAYTON INTL (DAY)

GPS required. For uncompensated Baro-VNAV systems, procedure NA below -19°C (-2°F) or above 54°C (130°F). For inop ALS, increase RNP 0.10 all Cats visibility to RVR 6000. For inop ALS, increase RNP 0.30 all Cats visibility to 1 5/8.

ALSF-2

MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to BONEE and hold.

ATIS	COLUMBUS APP CON	DAYTON TOWER	GND CON	CLNC DEL
125.8	118.425 323.15	119.9 257.7	121.9	121.75

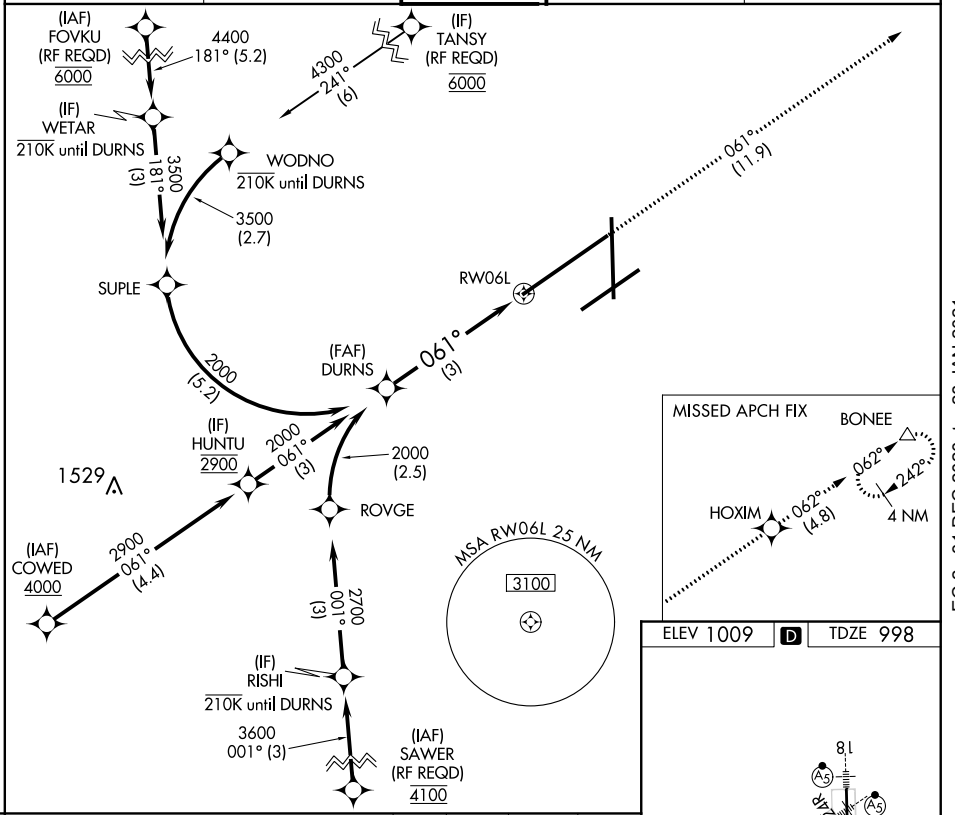

ELEV 1009 D TDZE 998

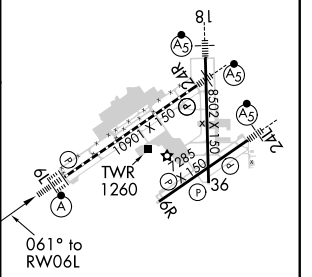

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 67).

3000	HOXIM	tr 062°	BONEE

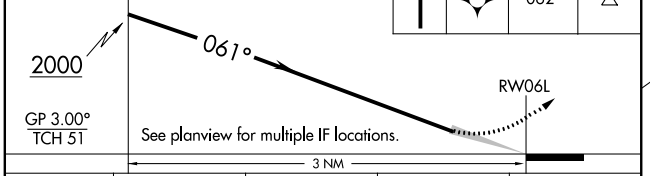

CATEGORY	A	B	C	D
RNP 0.10 DA	1358/40		360 (400-¾)	
RNP 0.30 DA	1464/60		466 (500-1¼)	

AUTHORIZATION REQUIRED

HIRL all Rwys
TDZ/CL Rwy 6L
REIL Rwys 6R and 36

EC-2, 31 DEC 2020 to 28 JAN 2021
EC-2, 31 DEC 2020 to 28 JAN 2021