

COLUMBUS, OHIO

AL-6846 (FAA)





20086

LOC/DME I-DDV	APP CRS	Rwy Idg	12102
110.1	052°	TDZE	736
Chan 38		Apt Elev	744

ILS RWY 5R (CAT II)
RICKENBACKER INTL (LCK)

ADF or DME required.		ALSIF-2	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.	

ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8	CLNC DEL 125.275 275.8
----------------	---------------------------------	----------------------------	--------------------------	---------------------------

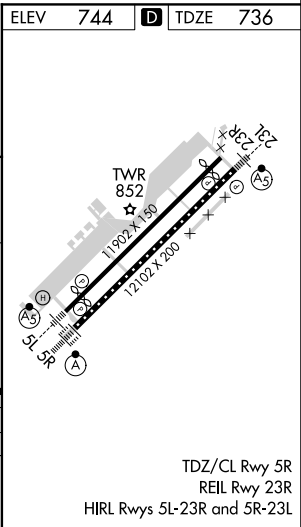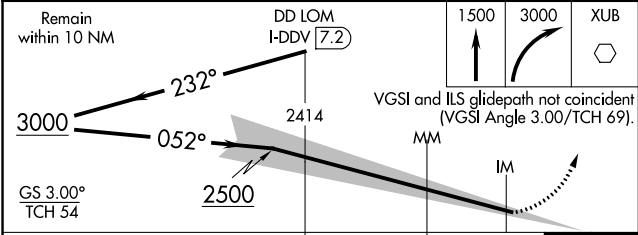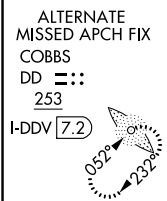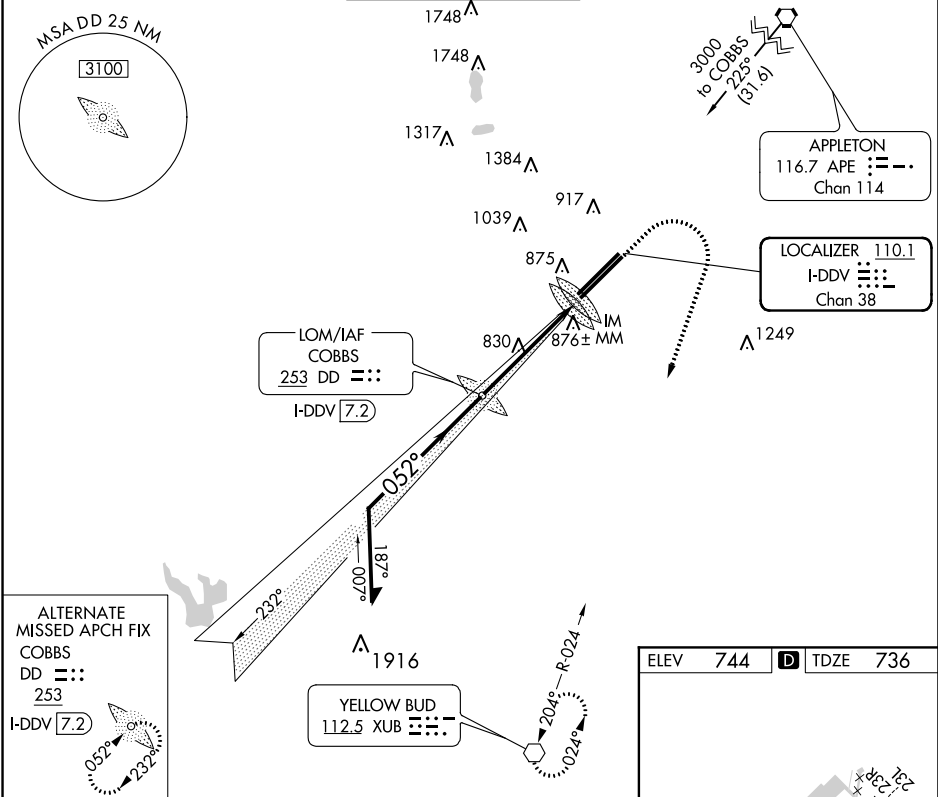

CATEGORY	A	B	C	D
S-ILS 5R		RA 100/12	100 DA 836	
CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED				

COLUMBUS, OHIO
Amdt 3C 05DEC19

39°49'N-82°56'W

RICKENBACKER INTL (LCK)
ILS RWY 5R (CAT II)

EC-2, 31 DEC 2020 to 28 JAN 2021

EC-2, 31 DEC 2020 to 28 JAN 2021

TDZ/CL Rwy 5R
REIL Rwy 23R
HIRL Rwy 5L-23R and 5R-23L