


ILS or LOC RWY 28L
JOHN GLENN COLUMBUS INTL (CMH)

MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 on heading 210° and on APE VORTAC R-242 to LIMPS INT/ APE 34.2 DME and hold.

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
-----------------	------------------------------------	-------------------------------	------------------------	-------------------	-------

APPLETON
116.7 APE :-
Chn 114

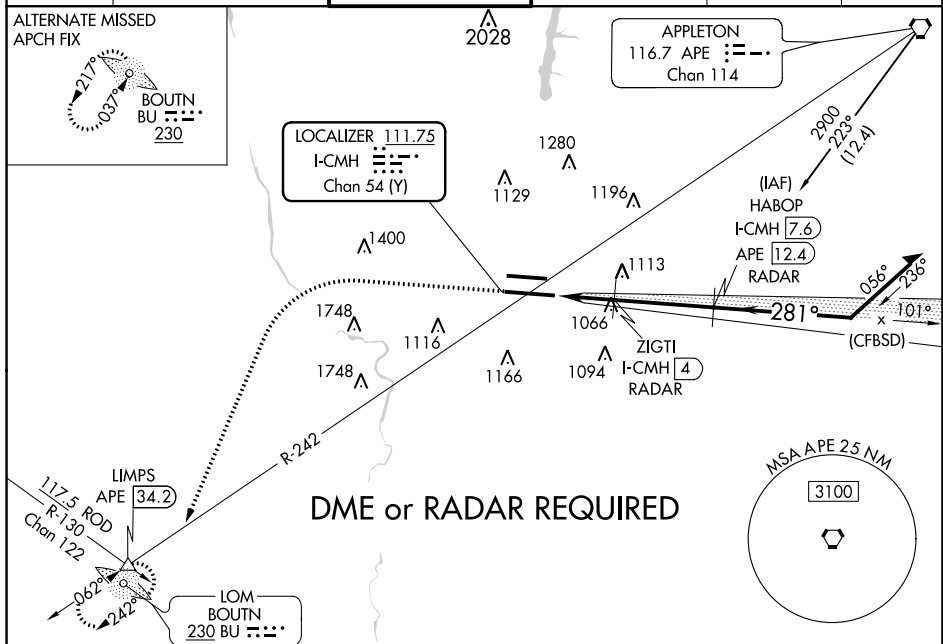

ELEV 815 D TDZE 815

***LOC only.**

CATEGORY	A	B	C	D
S-ILS 28L	1015/18 200 (200-½)			
S-LOC 28L	1560/24 745 (800-1)	745 (800-½)	1560/40 745 (800-¾)	1560-1¼ 745 (800-1¾)
C CIRCLING	1560-1 745 (800-1)	1560-1¼ 745 (800-1¼)	1560-2¼ 745 (800-2¼)	1560-2½ 745 (800-2½)
ZIGTI FIX MINIMUMS (DME OR RADAR REQUIRED)				
S-LOC 28L	1320/24 505 (600-½)	1320/55 505 (600-1)		
C CIRCLING	1340-1 525 (600-1)	1520-2 705 (800-2) 1540-2¼ 725 (800-2¼)		

TDZ/CL Rwy 10R-28L
HIRL Rwys 10R-28L and 10L-28R

FAF to MAP 5.8 NM

Knots	60	90	120	150	180
Min:Sec	5:48	3:52	2:54	2:19	1:56