


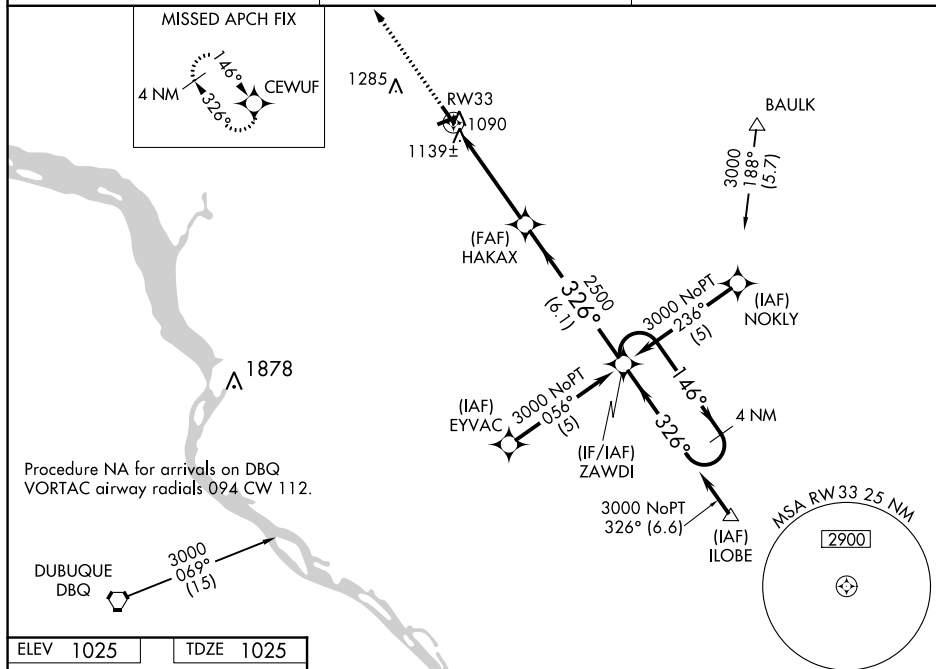

RNAV (GPS) RWY 33
PLATTEVILLE MUNI (PVB)

MISSED APPROACH:
Climb to 3000 direct
CEWUF and hold.

UNICOM
122.7 (CTAF) **L**


REIL Rwy 15 and 33 **(L)**
 MIRL Rwy 7-25 and 15-33 **(L)**

3000	CEWUF
	

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 25).

Holding Pattern

* LNAV only

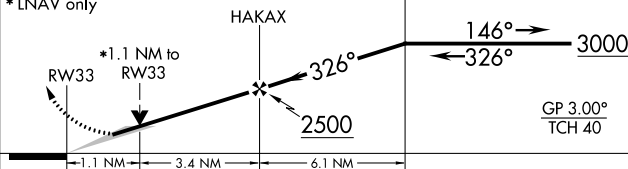

CATEGORY	A	B	C	D
LPV DA	1275-1 250 (300-1)			NA
LNAV/ VNAV DA	1441-1½ 416 (500-1½)			NA
LNAV MDA	1400-1 375 (400-1)			NA
CIRCLING	1440-1 415 (500-1)	1480-1 455 (500-1)	1480-1½ 455 (500-1½)	NA