


APP CRS	Rwy Idg	7569
055°	TDZE	708
	Apt Elev	727

RNAV (RNP) Z RWY 5

BUFFALO NIAGARA INTL (BUF)

<p>▼ For uncompensated Baro-VNAV systems, procedure below -18°C (0°F) or above 54°C (130°F). GPS required. For inoperative MALSR, increase RNP 0.10 all Cats visibility to 1¼ . For inoperative MALSR, increase RNP 0.30 all Cats visibility to 1½.</p>			<p>MALSR</p>	<p>MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to TRAVA and hold.</p>		
D-ATIS	BUFFALO APP CON	BUFFALO TOWER	GND CON	CLNC DEL	CPDLC	
135.35	126.15 263.125	120.5 257.8	133.2 257.8	124.7 257.8		

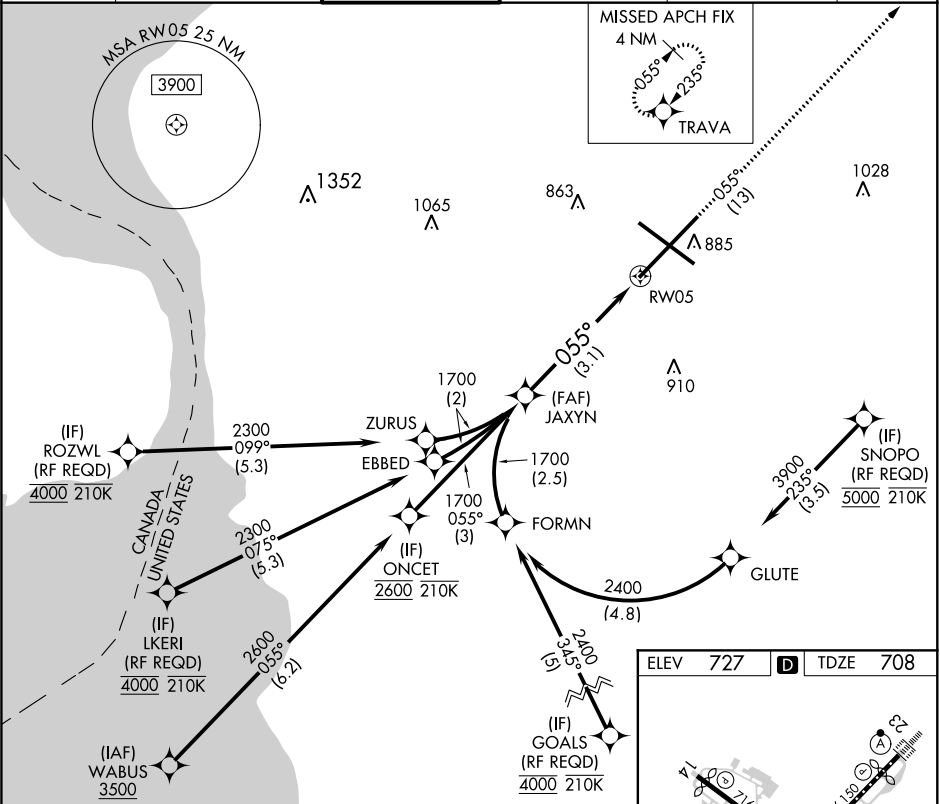

JAXYN		See planview for multiple IF locations		3000	TRAVA
1700		055°		RW05	
GP 3.00° TCH 46		3.1 NM			
CATEGORY	A	B	C	D	
RNP 0.10 DA	1065/45 357 (400-¾)				
RNP 0.30 DA	1159/60 451 (500-1¼)				
AUTHORIZATION REQUIRED					

