
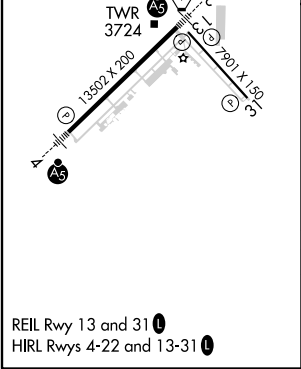
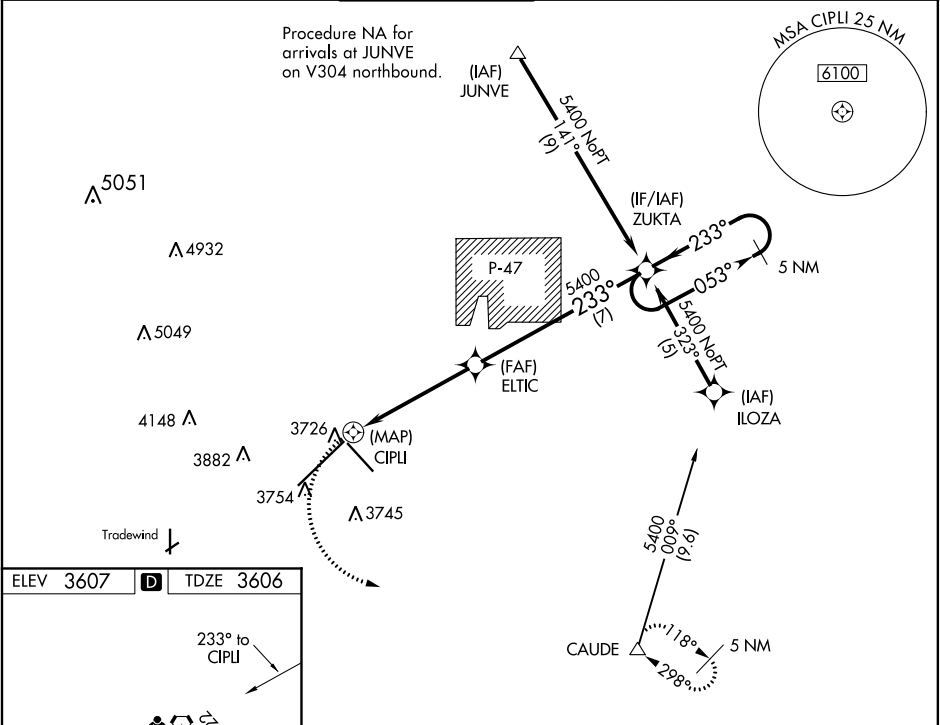


APP CRS	Rwy Idg	13502
233°	TDZE	3606
	Apt Elev	3607

RNAV (GPS) Y RWY 22
RICK HUSBAND AMARILLO INTL (AMA)

RNP APCH.			<div>MALSR</div> <div></div>	MISSED APPROACH: Climbing left turn to 5400 direct CAUDE and hold.		
<div><div><div><div><div>T</div><div>A</div></div></div><div>ASR</div></div><div>For inop ALS, increase Cat C/D/E visibility to RVR 6000.</div></div>						
ATIS 118.85 350.3	AMARILLO APP CON★ 119.5 307.0	AMARILLO TOWER★ 118.3(CTAF)0 257.9	GND CON 121.9 348.6	CLNC DEL 121.65 239.275	UNICOM 122.95	



<div>5400</div> <div>CAUDE</div> <div></div>		<div>VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 77).</div>		<div>5 NM</div> <div>Holding Pattern</div>		
<div></div>						
CATEGORY	A		B	C	D	E
LNAV MDA	4020-½ 414 (500-½)			4020-¾ 414 (500-¾)	4020-1	414 (500-1)
CIRCLING	4080-1 473 (500-1)			4240-1¾ 633 (700-1¾)	4280-2¼ 673 (700-2¼)	4460-3 853 (900-3)