


RNAV (GPS) Y RWY 23
CHARLOTTE/DOUGLAS INTL (CLT)

MISSED APPROACH: Climb to 4000 direct KECKS and hold, continue climb-in-hold to 4000.

RADAR REQUIRED

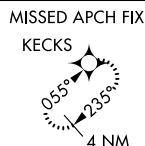

HIRL all Rwy's
REIL Rwy's 18L and 23
TDZ/CL Rwy's 18R, 36L, 36C and 36R

4000 KECKS VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 54). JEPH5

* LNAV only

DOVSE 1.9 NM to RW23

LECAR 2500

ATELL

6000

*1.2 NM to RW23

RW23

*1400

2500

236°

4000

GP 3.00° TCH 58

1.2 0.7 3.4 NM 4.8 NM 7.5 NM

CATEGORY	A	B	C	D
LPV DA	947/40	200 (200-¾)		
LNAV/DA	1222-1⅓	475 (500-1⅓)		
LNAV MDA	1180/50 433 (500-1)	1180/60 433 (500-1¼)	1180-1½ 433 (500-1½)	
C CIRCLING	1380-1 632 (700-1)	1500-2¼ 752 (800-2¼)	1500-2½ 752 (800-2½)	