


WAAS CH 93536 W09A	APP CRS 094°	Rwy Idg TDZE Apt Elev	4004 38 38
--	------------------------	-----------------------------	---------------------------------------

RNAV (GPS) RWY 9

HENDERSON FIELD (ACZ)

RNP APCH.	<p>▼ Rwy 9 helicopter visibility reduction below 1 SM NA. Baro-VNAV NA. ▲ NA Use Wilmington altimeter setting; when not received, use Kenansville altimeter setting. Straight-in and Circling Rwy 9 NA at night.</p>	MISSED APPROACH: Climb to 2000 direct EJABI and hold.
-----------	--	---

WILMINGTON INTL ASOS 124.975	WILMINGTON APP CON ★ 135.75 317.425	UNICOM 122.8 (CTAF) 0
--	---	---------------------------------

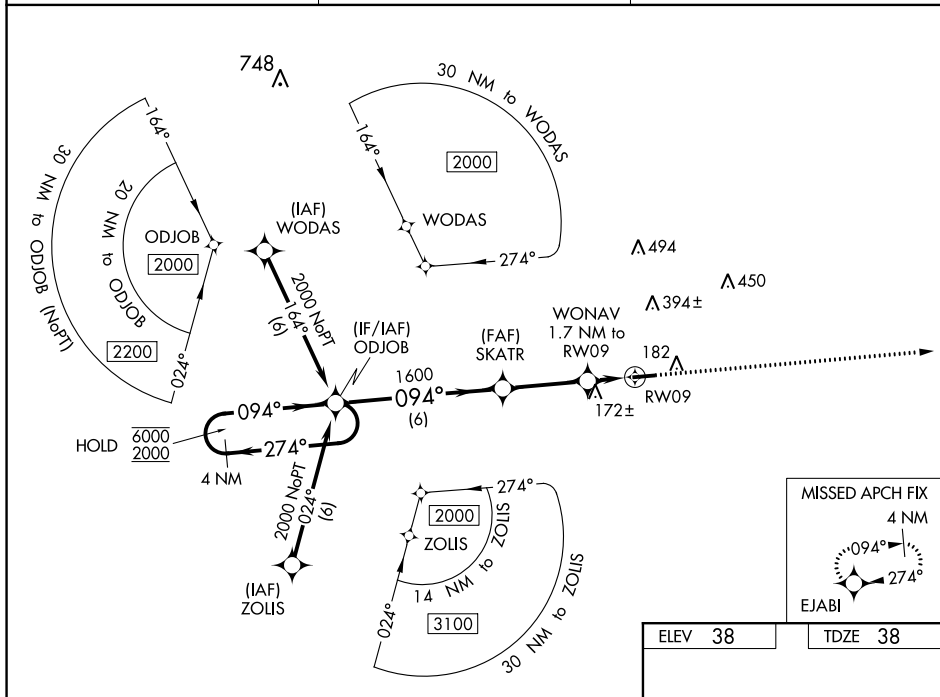

4 NM Holding Pattern		VGSI and RNAV glidepath not coincident (VGSI Angle 3.10/TCH 40).		2000	EJABI
GP 3.00° TCH 51		*LNNAV only.		094° to RW09	
6000 ← 274°		1600		4153 X 75	
094° →		*620		0	
6 NM		3.1 NM		1.7 NM	
CATEGORY	A	B	C	D	
LPV DA	401-1		363 (400-1)		
LNNAV/VNAV DA	538-1½		500 (500-1½)		
LNNAV MDA	500-1 462 (500-1)		500-1¾ 462 (500-1¾)		
◼ CIRCLING	620-1 582 (600-1)		820-2¼ 782 (800-2¼)		
				MIRL Rwy 9-27 0	