

WAAS CH 40208 W35A	APP CRS 355°	Rwy Idg 8006 TDZE 163 Apt Elev 214
--	------------------------	---

RNAV (GPS) RWY 35

BOB SIKES (CEW)

RNP APCH.


▼

▲

Baro-VNAV and VDP NA when using Eglin AFB altimeter setting. Rwy 35 helicopter visibility reduction below ¾ SM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -5°C or above 54°C. When local altimeter setting not received, use Eglin AFB altimeter setting and increase LPV DA to 509, LNAV/VNAV DA to 550, and all MDA 60 feet, increase LNAV Cat C/D visibility ½ SM.

MISSED APPROACH: Climb to 2000 direct WEDOM and hold.

ASOS 119.275	EGUN APP CON 124.05 284.65	UNICOM 122.95 (CTAF) 0
------------------------	--------------------------------------	----------------------------------

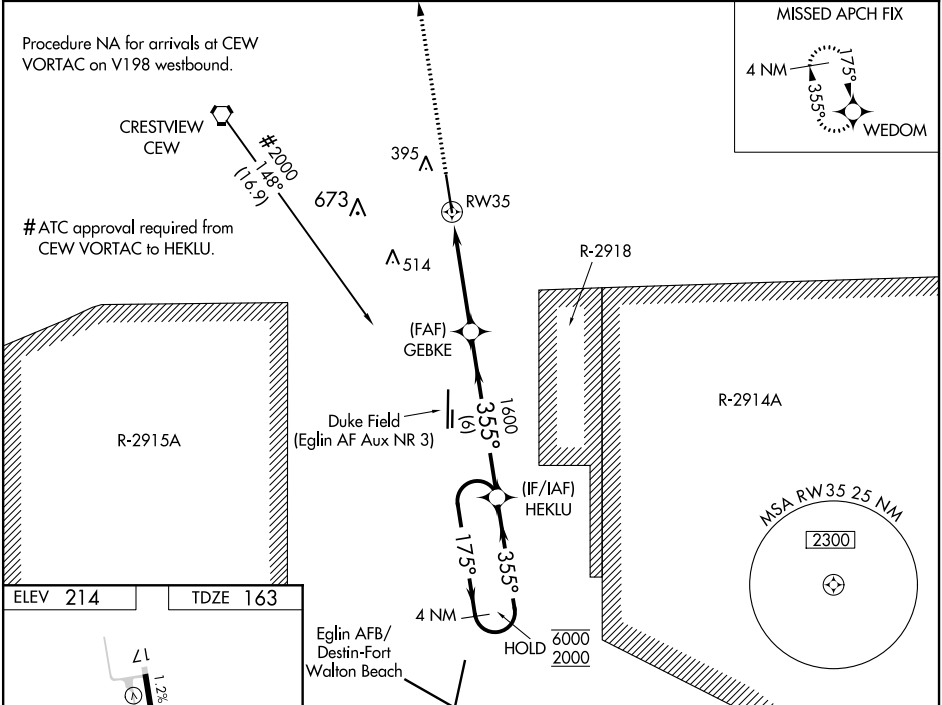

ELEV 214

TDZE 163

2000

WEDOM

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 62).

4 NM Holding Pattern

HEKLU

175°

6000

355°

2000

GP 3.00°

TCH 52

1600

355°

1600

1.3 NM

3 NM

6 NM

RW35

1.3 NM

3 NM

6 NM

1600

355°

1600

CATEGORY	A	B	C	D
LPV DA	450-1 287 (300-1)			
LNAV/VNAV DA	491-1¼ 328 (300-1¼)			
LNAV MDA	640-1 477 (500-1)		640-1⅜ 477 (500-1⅜)	

CRESTVIEW, FLORIDA

Bob Sikes (CEW)

Amtd 1D 18JUL19

30°47'N-86°31'W

RNAV (GPS) RWY 35