
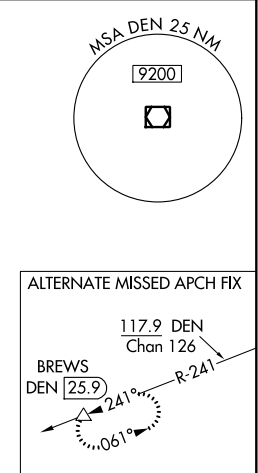
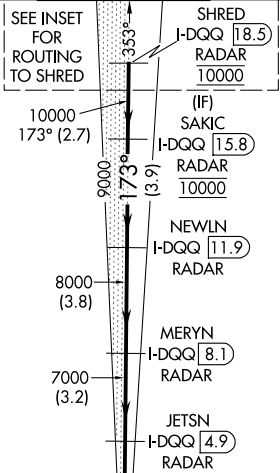


LOC/DME I-DQQ 111.9 Chan 56	APP CRS 173°	Rwy Idg 16000 TDZE 5326 Apt Elev 5434
---	------------------------	--


ILS or LOC RWY 16R
DENVER INTL (DEN)

▼ For inoperative MALS, increase S-LOC Cat C/D visibility to RVR 4500. Simultaneous approach authorized with Rwy 17L and 17R. DME required.	MALS 	MISSED APPROACH: Climb to 5900 then climbing right turn to 12000 on heading 218° and on FGF VORTAC R-254 to BREWS/FQF 26 DME and hold.
--	-----------------	---

D-ATIS ARR 125.6 379.9 DEF 134.025	DENVER APP CON 119.3 307.3 120.35 379.3 (NORTH) (SOUTH)	DENVER TOWER 135.3 351.95	GND CON 127.5 379.175	CLNC DEL 118.75	CPDLC
--	--	-------------------------------------	---------------------------------	---------------------------	-------

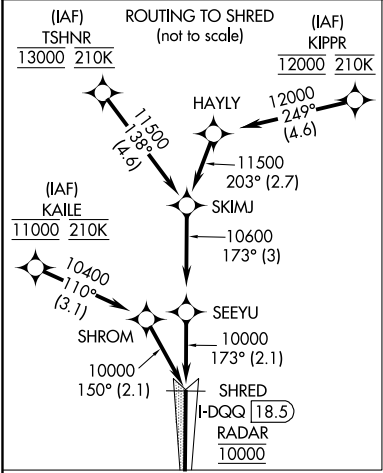

RADAR or GPS REQUIRED

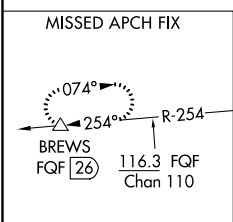

LOCALIZER **111.9**
I-DQQ
Chan **56**

DENVER
117.9 DEN
Chan **126**

