


WAAS CH 63141 W36A	APP CRS 022°	Rwy Idg TDZE Apt Elev	3400 275 275
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 36


MANLEY HOT SPRINGS (MLY)(P.A.M.L)

RNP APCH.	When Tanana altimeter setting not received, procedure NA. Circling NA west of Rwy 18-36. Rwy 36 helicopter visibility reduction below ¾ SM NA. Procedure NA at night.	MISSED APPROACH: Climbing right turn to 4400 direct OLSEE and hold.
▼		
▲ NA		
☼ -22°C		

TAL/PATA ASOS 135.1	ANCHORAGE CENTER 120.9 319.2	FAIRBANKS RADIO 122.3 122.65	UNICOM 122.8(CTAF) 0
-------------------------------	--	--	--------------------------------

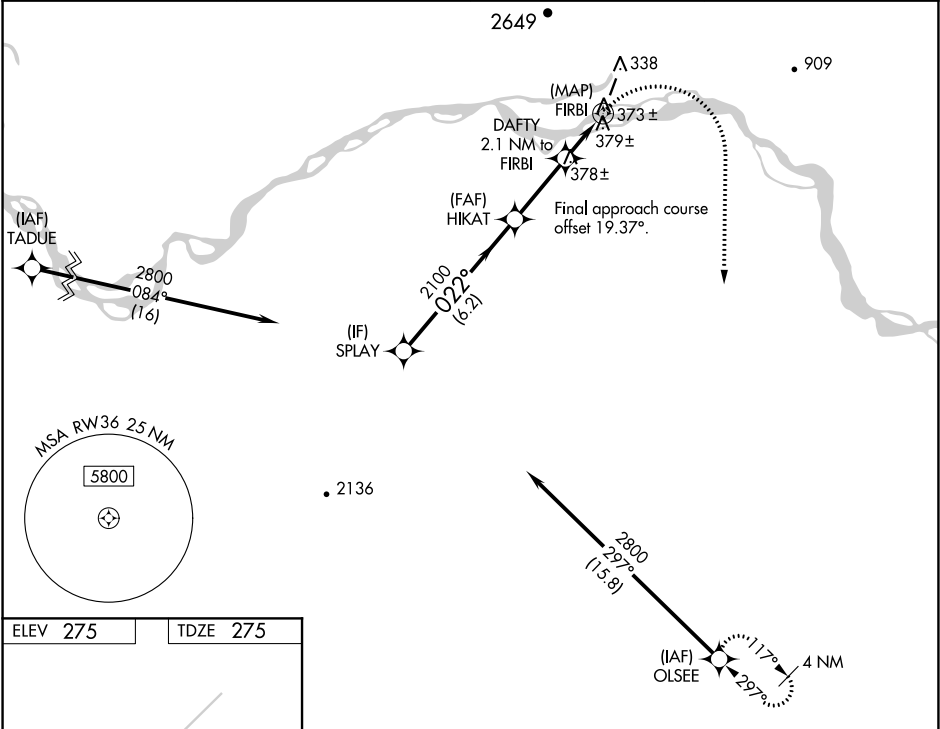

ELEV 275	TDZE 275
----------	----------

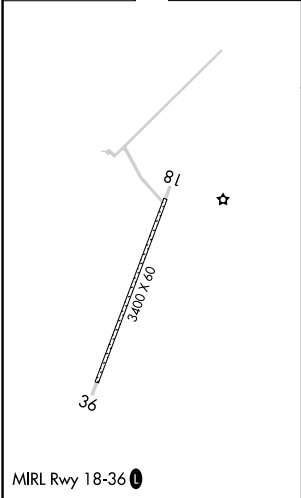

SPLAY		HIKAT		DAFTY 2.1 NM to FIRBI		FIRBI		4400	OLSEE
2800		022°		2100		1200			
		2.98° TCH 40							
		6.2 NM		2.8 NM		2.1 NM		0.7	
CATEGORY	A	B		C		D			
LP MDA	720-1	445 (500-1)		720-1 ¾		445 (500-1 ¾)		NA	
LNAV MDA	1020-1	1020-1 ¼		1020-2		745 (800-2)		NA	
	745 (800-1)	745 (800-1 ¼)							
☐ CIRCLING	1140-1 ¼	1280-1 ¼		1580-3				NA	
	865 (900-1 ¼)	1005 (1100-1 ¼)		1305 (1400-3)					