


LOC I-BUZ <b>111.7</b>	APP CRS <b>037°</b>	Rwy Idg <b>5500</b> TDZE <b>904</b> Apt Elev <b>904</b>
---------------------------	------------------------	---------------------------------------------------------------

ILS or LOC RWY 4  
BOLTON FIELD (TZR)

ADF required. RADAR required for procedure entry.	MALSR 	MISSED APPROACH: Climb to 1400 then climbing right turn to 2700 direct BU LOM and hold.
AutoPilot coupled approach NA below 1144.		

AWOS-3 <b>135.925</b>	COLUMBUS APP CON <b>134.0 279.6</b>	BOLTON TOWER ★ <b>128.1 (CTAF) 0</b>	GND CON <b>121.8</b>
--------------------------	----------------------------------------	-----------------------------------------	-------------------------

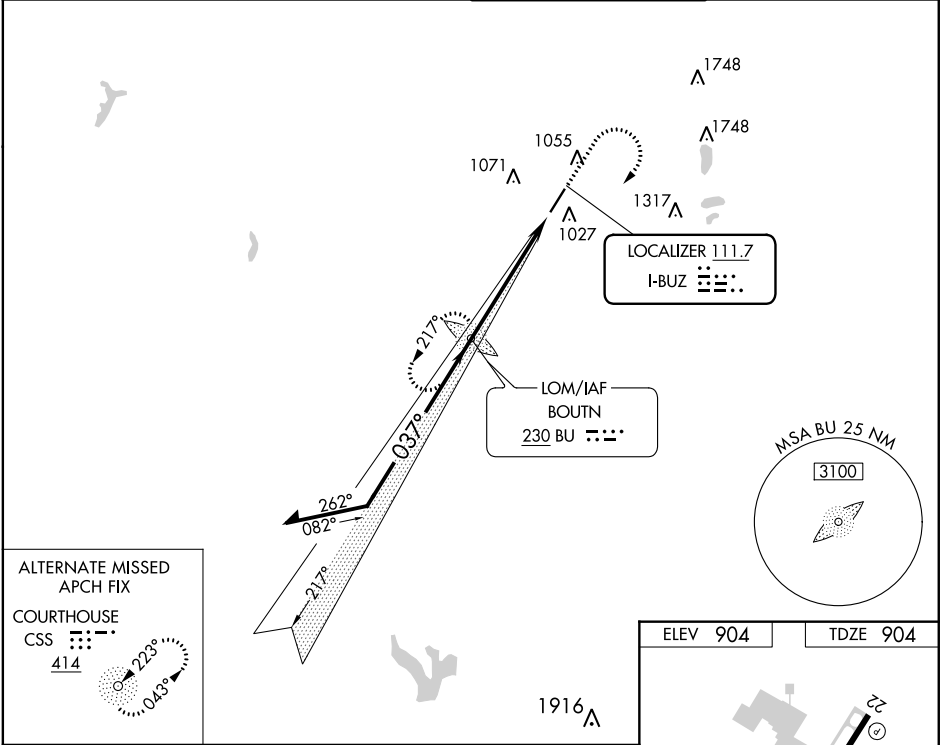

Remain within 10 NM				
BU LOM 2682				
VGSi and ILS glidepath not coincident (VGSi Angle 3.00/TCH 25).				
GS 3.00° TCH 41				
5.4 NM				
CATEGORY	A	B	C	D
S-ILS 4	1104-½ 200 (200-½)			
S-LOC 4	1360-½ 456 (500-½)	1360-⅞ 456 (500-⅞)	1360-1 456 (500-1)	
CIRCLING	1360-1 456 (500-1)	1380-1 476 (500-1)	1380-1½ 476 (500-1½)	1500-2 596 (600-2)

