

LOC I-UXL

109.3

APP CRS

146°

Rwy Idg

5001

TDZE

10

Apt Elev

10

LOC RWY 15

SOUTHLAND FIELD (UXL)

▼



▲

Inoperative table does not apply to S-15 Cat C. Visibility reduction by helicopters NA. When local altimeter setting not received, use Lake Charles Rgnl altimeter setting and increase all MDA 20 feet.

ODALS

MISSED APPROACH: Climb to 500 then climbing right turn to 2400 direct AUR NDB and hold, continue climb-in-hold to 2400.

AWOS-3PT 118.175	LAKE CHARLES APP CON ★ 119.35 282.3	UNICOM 122.8 (CTAF) 0
---------------------	--	--------------------------

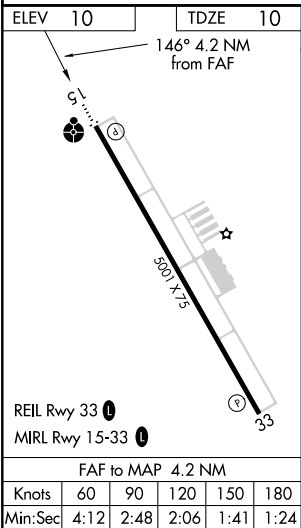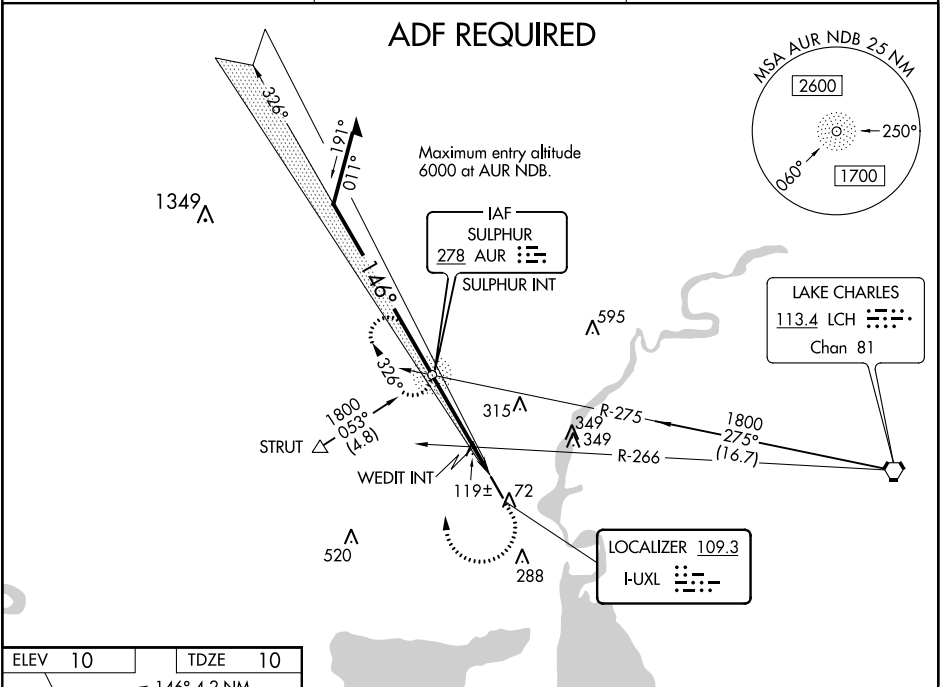

* 500 when using Lake Charles Rgnl altimeter setting.			
Remain within 10 NM			
VGSi and descent angles not coincident (VGSi Angle 3.00/TCH 50).			
WEDIT FIX MINIMUMS			
S-15	480-3/4	470 (500-3/4)	480-1 1/4
CIRCLING	480-1	520-1	640-2
S-15	380-3/4	370 (400-3/4)	380-1 1/4
CIRCLING	420-1	520-1	640-2